

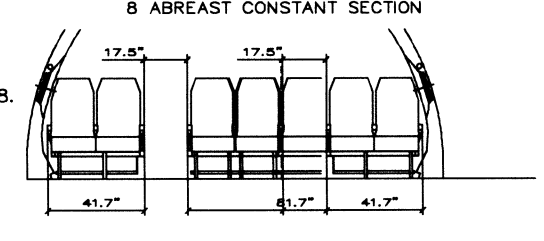
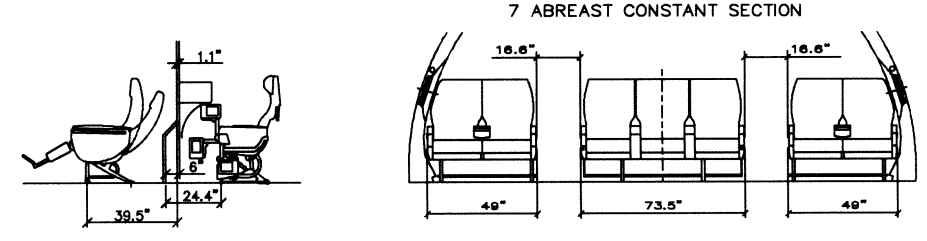


CABIN INTERIOR INFORMATION									
CLASS	SEAT	PITCH	ABREAST	LAV.	GALLEY	TROLLEY	C/A SEAT	STOWAGE	COAT
FC	12	69"-71"	6	1	2	9.5	3	1	1
BC	42	59"	7	2	2	10	2	2	—
TC	183	32"-31"	8	4	2	16	8	2	—
TOTAL	237	31"-71"	6/7/8	7	6	35.5	13	5	1

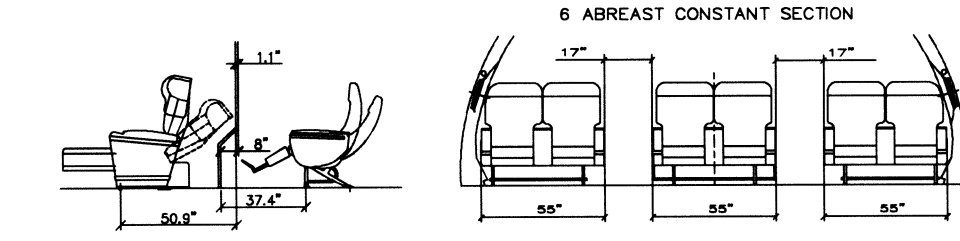

ALL SEATS EQUIPPED WITH IN-SEAT VIDEO (ARMREST OR BACKREST) EXCEPT ROWS 6, 11, 24, LATERAL SEATS ROW 38. AND CTR SEAT ROW 39

	(A)	(B)	(C)	(D)	(E)	SRP
FC	—	—	—	—	—	—
BC	—	—	—	—	—	—
TC	-0.33"	20"	26.02"	—	6.25"	18.68"
FC	2.11"	21"	33.60"	24.68"	21.29"	18.25"
BC	7.63"	19"	32.63"	28"	9.5"	11"
TC	-0.33"	20"	26.02"	—	6.25"	18.68"

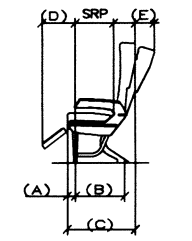

- GENERAL NOTES:
- A6-EKS(MSN0283), A6-EKT(MSN0293), A6-EKU(MSN0295), A6-EKV(MSN0314), A6-EKW(MSN0316), A6-EKX(MSN0326), A6-EKY(MSN0328), A6-EAD(MSN0382), A6-EAE(MSN0384), A6-EAF(MSN0392), A6-EAG(MSN0396), A6-EAH(MSN0409), A6-EAJ(MSN0437), A6-EAK(MSN0451), A6-EAM(MSN0491), A6-EAN(MSN0494), A6-EAO(MSN0509), A6-EAP(MSN0525) and A6-EAR(MSN0536)
  - AIRBUS DWG NO.330-25-03357  
EO EE25-0048 R04 (per EK Part 21 MB330-25-0009 issue INITIAL)  
EO EE25-0060 R01 (per EK Part 21 MB330-25-0010 issue INITIAL)  
EO AE-25-3257 & EO EE23-0004

- T FOLDABLE WORK TABLE 12" DEEP, WIDTH
- ST STRETCHER LOCATION
- RLD RECLINE LOCKING DEVICE
- NT NURSING TABLE
- LS STANDARD LITERATURE POCKET
- LL LARGE LITERATURE POCKET
- LCD LCD SCREEN 7-10"
- H HANDICAPPED FACILITIES
- FC FLEXI CONTAINER
- D DOGHOUSE (MAX DIMENSIONS)
- BB PROV. FOR BABY BASSINET
- 20" 20" VIDEO MONITOR
- 16" 16" VIDEO MONITOR
- 16" 16" VIDEO MONITOR (DEACTIVATED)
- /// DUMMY PANELS
- ⊙ OUTSIDE C.C.G.
- N NARROW SEAT
- LIMITED BREAK OVER IN ARMREST TABLE
- \* SEAT STUD LOCATION

DRAWN ABDUL KAMMAN NISAR	DATE 04 Oct 12	TITLE INTERIOR ARRANGEMENT DIAGRAM
CHECKED MARGARET TORCEDO	DATE 04 Oct 2012	12 F/C + 42 B/C + 183 E/C = 237
VERIFIED JERSON MERCADO	DATE 04 Oct 2012	REVISION 01
APPROVED YOUSSEF MANSOUR	DATE 04 Oct 2012	MODEL A330-200
MANAGEMENT APPROVAL MOHAMMAD AL SIRHAN	DATE 07 Oct 12	SCALE NOT TO SCALE (SCALE APPLICABLE TO MASTER ONLY)
EFFECTIVITY SEE NOTE 1.	REFERENCE SEE NOTE 2.	

REVISIONS		
REV	DESCRIPTION	DATE
01	1. UPDATE THE EFFECTIVITY SECTION TO REFLECT ALL AFFECTED AIRCRAFT REGISTRATION NUMBERS AND THEIR EQUIVALENT MSN. 2. UPDATE THE REFERENCE SECTION TO REFLECT THE FOLLOWING: - LATEST REVISION OF EO EE25-0048 R04 (WAS R03) AND ITS ASSOCIATED MOD BULLETIN MB330-25-0009 ISSUE INITIAL - LATEST REVISION OF EO EE25-0060 R01 (WAS R00) AND ITS ASSOCIATED MOD BULLETIN MB330-25-0010 ISSUE INITIAL	04 OCT 2012